



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246



D119-796-241TRN
Job Sheet 192952



Part No: D119-796-241TRN

Job Qty: 1 pcs

Part Name: Crosstube Turning Detail



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 4/4/19

Job Tracking No:

Due Date: 4/18/19

Created By: Marie Lajeunesse

Type: Stock

Description:

Note: DWG REV J IPP REV A RQ 14/05/27 VERIFIED BY DD IPP REV:B 16.05.04 AS PER DWG REV.I DD
VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		DAS	Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time		
100	Mori Seiki TL-40 - 1	1 pcs	4/18/19	4/18/19	1.77	1.72	Mori Seiki TL-40 - 1		66	2019-05-14
110	QC 2	1 pcs	4/18/19	4/18/19	0.00	0.00	QC 2 - 1		9-89	
							QC 2 - 12			
							QC 2 - 14			
							QC 2 - 17			
							QC 2 - 19			
							QC 2 - 2			
							QC 2 - 20			
							QC 2 - 22			
							QC 2 - 23			
							QC 2 - 25			
							QC 2 - 32			
							QC 2 - 33			
							QC 2 - 35			
							QC 2 - 39			
							QC 2 - 4			
							QC 2 - 40			
							QC 2 - 44			
							QC 2 - 45			
							QC 2 - 48			
							QC 2 - 49			
							QC 2 - 50			
							QC 2 - 51			
							QC 2 - 52			
							QC 2 - 56			
							QC 2 - 57			
							QC 2 - 62			
							QC 2 - 63			
							QC 2 - 8		DAS	
							QC 2 - 66		66	2019-05-14
									9-89	

Plex 4/4/19 11:41 AM Dart.lajeunesse.marie

					QC 2 - 64	
					QC 2 - 65	
					QC 2 - 5	DAS
120	Mori Seiki TL-40 - 1 - B4B	1 pcs	4/18/19	0.00 1.72	Mori Seiki TL-40 - 1 - B4B	66 2019-05-16
130	QC 2	1 pcs	4/18/19	0.00 0.00	QC 2 - 1	9-89
					QC 2 - 12	
					QC 2 - 14	
					QC 2 - 17	
					QC 2 - 19	
					QC 2 - 2	
					QC 2 - 20	
					QC 2 - 22	
					QC 2 - 23	
					QC 2 - 25	
					QC 2 - 32	
					QC 2 - 33	
					QC 2 - 35	
					QC 2 - 39	
					QC 2 - 4	
					QC 2 - 40	
					QC 2 - 44	
					QC 2 - 45	
					QC 2 - 48	
					QC 2 - 49	
					QC 2 - 50	
					QC 2 - 51	
					QC 2 - 52	
					QC 2 - 56	
					QC 2 - 57	
					QC 2 - 62	
					QC 2 - 63	
					QC 2 - 8	DAS
					QC 2 - 66	66 2019-05-16
					QC 2 - 64	9-89
					QC 2 - 65	
					QC 2 - 5	
140	QC 8	1 pcs	4/18/19	0.00 0.00	QC 8 - 12	
					QC 8 - 14	
					QC 8 - 17	
					QC 8 - 20	
					QC 8 - 25	
					QC 8 - 3	
					QC 8 - 32	
					QC 8 - 33	
					QC 8 - 35	
					QC 8 - 39	
					QC 8 - 4	
					QC 8 - 44	
					QC 8 - 45	
					QC 8 - 49	
					QC 8 - 58	
					QC 8 - 8	
					QC 8 - 9	
					QC 8 - 68	
					QC 8 - 67	GP 19-05-23
					QC 8 - 1 (A)	
					QC 8 - 47	
					QC 8 - 40	
					QC 8 - 52	

				QC 8 - 23	
145 Crosstubes - 2 - B4B	1 pcs	4/18/19	0.00 0.45	Crosstubes - 1 - B4B	
				Crosstubes - 2 - B4B	
				Crosstubes - 3 - B4B	BB 6/6/2019
				Crosstubes - 4 - B4B	
150 Crosstubes - 3 - B4B	1 pcs	4/18/19	0.00 0.33	Crosstubes - 1 - B4B	
				Crosstubes - 2 - B4B	BB 19-07-04.
				Crosstubes - 3 - B4B	
				Crosstubes - 4 - B4B	
160 QC 7	1 pcs	4/18/19	0.00 0.00	QC 7 - 10	
				QC 7 - 13	
				QC 7 - 14	
				QC 7 - 15	
				QC 7 - 17	
				QC 7 - 18	
				QC 7 - 19	
				QC 7 - 2	
				QC 7 - 28	
				QC 7 - 3	
				QC 7 - 30	
				QC 7 - 34	
				QC 7 - 36	
				QC 7 - 37	
				QC 7 - 41	
				QC 7 - 47	
				QC 7 - 48	
				QC 7 - 51	
				QC 7 - 58	
				QC 7 - 59	
				QC 7 - 60	
				QC 7 - 9	
				QC 7 - 68	
				QC 7 - 50	DAS
				QC 7 - 67	GP 67-05.
				QC 7 - 40	9-89
170 Packaging 3-1 - Stock - B4B	1 pcs	4/18/19	0.00 0.00	Packaging 3 - 1 - B4B	
				Packaging 3 - 2 - B4B	
				Packaging 3 - 3 - B4B	
				Packaging 3 - 4 - B4B	
				Packaging 3 - 5 - B4B	
				Packaging 3 - 6 - B4B	
				Packaging 3 - 7 - B4B	
				Packaging 3 - 8 - B4B	
				Packaging 3 - 9 - B4B	
				Packaging 3 - 10 - B4B	
				Packaging 3 - 11 - B4B	
				Packaging 3 - 12 - B4B	
				Packaging 3 - 13 - B4B	
				Packaging 3 - 14 - B4B	
				Packaging 3 - 15 - B4B	
				Packaging 3 - 16 - B4B	
				Packaging 3 - 17 - B4B	
				Packaging 3 - 18 - B4B	
				Packaging 3 - 19 - B4B	
				Packaging 3 - 20 - B4B	
				Packaging 3 - 21 - B4B	
				Packaging 3 - 22 - B4B	
				Packaging 3 - 23 - B4B	
				Packaging 3 - 24 - B4B	

				Packaging 3 - 25 - B4B	
				Packaging 3 - 26 - B4B	
				Packaging 3 - 27 - B4B	
				Packaging 3 - 28 - B4B	
				Packaging 3 - 29 - B4B	
				Packaging 3 - 30 - B4B	
				Packaging 3 - 31 - B4B	
				Packaging 3 - 32 - B4B	
				Packaging 3 - 33 - B4B	
				Packaging 3 - 34 - B4B	
				Packaging 3 - 35 - B4B	
				Packaging 3 - 36 - B4B	
180 QC 21 - FG	1 pcs	4/18/19	0.00 0.00	QC 21 - FG - 21	DAS
				QC 21 - FG - 70	21
				QC 21 - FG - 53	3-53

Part Op 100 - 1-Fill tube with sand & install plugs on both ends as per Folio FB298 2-Turn first side as per Folio FB298
 Descriptions: 110 - (QC2- Inspect parts off machine FAI/FAIB)
 120 - 1-Turn second side as per Folio FB298
 130 - (QC2- Inspect parts off machine FAI/FAIB)
 140 - (QC8- Inspect parts - second check)
 145 - GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.
 150 - 1- handfinish X-TUBE INSIDE AND OUT
 160 - (QC7-Inspect Chemical Conversion Coat)
 170 - (Identify as per dwg & Stock Location: _____) LOCATION : LG014
 180 - (QC21- Final Inspection - Work Order Release)

Job BOM				
Part / Item	Component Name	Quantity	Operation	Container
D6023-106	Crosstube Material	1 pcs (1 ea)	100-Mori Seiki TL-40 - 1	5013837

Job Allocations				
Operation	Component Part	Required	Inventory	Allocated
100-Mori Seiki TL-40 - 1	D6023-106	1	18	0

Part Specifications	
Specifications could not be found.	



Container No: S181042



Part: D119-796-241TRN

Job No: 192952

Serial No/Batch: S181042

Revision:

Inspector:

Exp Date:

Instructions:

Dart Aerospace Ltd.
 1270 Aberdeen Street
 Hawkesbury, ON K6A 1K7
 CANADA
 TEL.: 1 613 632-5200
 Email: sales@dartaero.com
 www.dartaerospace.com

Date: 05/14/19

Plex 4/4/19 11:41 AM Dart.lajeunesse.marie

①

DART AEROSPACE LTD	Work Order: 192952
Description: Crosstube Assembly (AW119 MKII Aft)	Part Number: D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: J	Page 1 of 2


FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	5.88	+/-0.030	5.876	✓		CNC-08	
	2.516	+0.005/-0.000	2.521	✓		CNC-04	
	2.626	+0.005/-0.000	2.631	✓			
	2.627	+0.005/-0.000	2.632	✓			
	2.798	+0.005/-0.000	2.803	✓			
	2.799	+0.005/-0.000	2.803	✓			
	2.989	+0.005/-0.000	2.994	✓			
	3.191	+0.005/-0.000	3.194	✓		CNC-05	
	3.200	+0.005/-0.000	3.205	✓		"	
SIDE B	5.88	+/-0.030	5.874	✓		CNC-08	
	2.516	+0.005/-0.000	2.521	✓		CNC-04	
	2.626	+0.005/-0.000	2.631	✓			
	2.627	+0.005/-0.000	2.632	✓			
	2.798	+0.005/-0.000	2.803	✓			
	2.799	+0.005/-0.000	2.803	✓			
	2.989	+0.005/-0.000	2.994	✓			
	3.191	+0.005/-0.000	3.196	✓		CNC-05	
	3.200	+0.005/-0.000	3.205	✓		"	
	105.71	+/-0.020	105.72	✓		Tape	

①

DART AEROSPACE LTD	Work Order: 192952
Description: Crosstube Assembly (AW119 MKII Aft)	Part Number: D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: J	Page 2 of 2

WALL THICKNESS MEASUREMENT

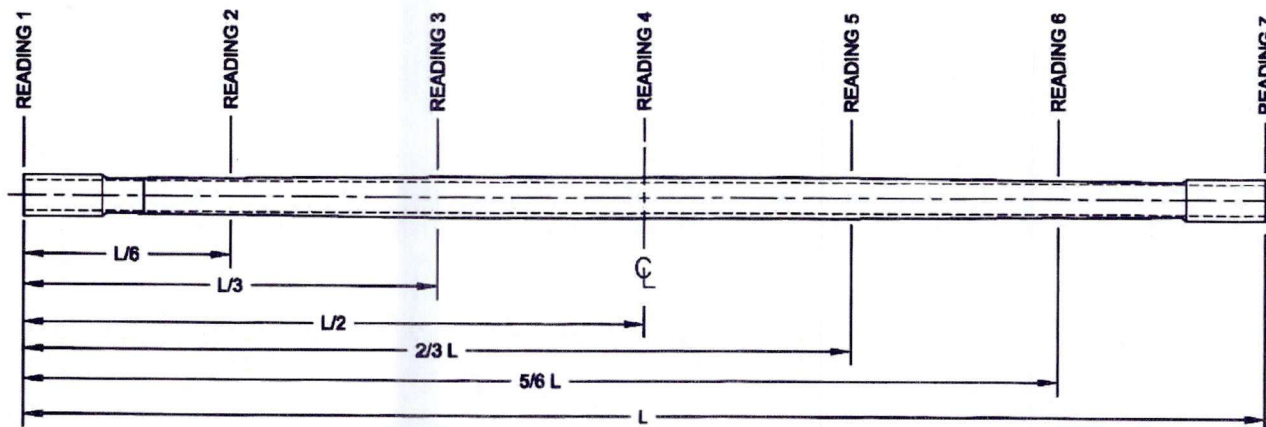

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.126	.122	.130	.135	.013	0.030"
READING 2 L= 17.618	.207	.196	.195	.207	.012	
READING 3 L= 35.236	.311	.293	.292	.311	.019	0.063"
READING 4 L= 52.855	.484	.469	.475	.491	.022	
READING 5 L= 70.473	.302	.290	.302	.312	.022	
READING 6 L= 88.092	.190	.189	.213	.218	.029	0.030"
READING 7 L= 105.71	.135	.130	.121	.126	.014	

Calibration Result

Actual Block Thickness: 100-500

SITESCAN 250 Measured Thickness: 100-500


Measured by: **DAS 66**
Date: 2019-05-16

Audited by: **DAS 67**
Date: 19-05-23

Preliminary Approval: _____
Date: _____

Rev	Date	Change	Revised by	Approved
B	15.03.12	Dimensions updated per Dwg Rev F (P/O D119-796-201)	KJ	
C	15.04.14	Tolerance dimensions revised on Wall Thickness table	KJ	
D	15.05.14	Tolerances revised per Dwg Rev G	KJ	
E	15.09.09	Dwg Rev updated	KJ	
F	16.05.27	Dwg Rev updated	KJ	
G	17.07.12	Dwg Rev updated	KJ	
H	18.05.24	Tolerance dimensions revised on Wall Thickness table	MG	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 192952 MJS
19-04-04

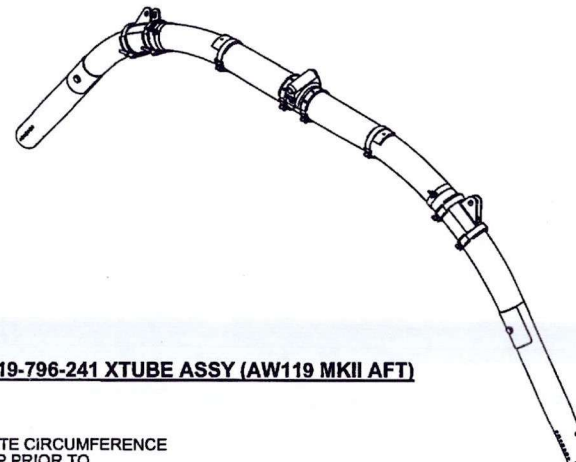

D119-796-241 XTUBE ASSY (AW119 MKII AFT)

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: MASK D5134-041/-042 DAMPER SUPPORT ASSEMBLIES, CUFFS, D5136-1/-2 CONTACT PADS, THE COMPLETE CIRCUMFERENCE OF THE TUBE UNDER THE D5122-1 CENTER SUPPORT AND THE TAB ON THE D5515-1 GROUNDING CLAMP PRIOR TO APPLICATION OF CLEAR COAT/PAINT.
IF NECESSARY TOUCH UP PRIMER ON OUTSIDE OF CROSSTUBE PER DART QSI 005 4.2.
APPLY MATTE CLEAR COAT TO THE UNDERSIDE OF CROSSTUBE AS SHOWN (B4-2, HATCHED AREA) PER QSI 005 4.2.
MASK THE UNDERSIDE OF CROSSTUBE AS SHOWN (B4-2, HATCHED AREA).
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-241" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 26.26 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) INSTALL D5122-1 CENTER SUPPORT HAND TIGHT ONLY. DO NOT TORQUE. INSTALL RED TAG TO INDICATE "D5122-1 CENTER SUPPORT MUST BE BONDED PER IIN-D119-796 PRIOR TO FLIGHT".
- 10) PRIOR TO FINISHING, ABRASE MATING SURFACES OF D5136-1/-2 AND SURFACE OF CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5136-1/-2 CONTACT PADS AND INSTALL AT AN 8.4° OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL MS21920-25 CLAMPS AND D5123-5 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY, THE NUT HAS NOT BOTTOMED-OUT AFTER TORQUING AND THE NUT IS FACING AFT.
- 12) PRIOR TO FINISHING, POSITION AND INSTALL D5134-041/-042 DAMPER SUPPORTS USING JIG DT10085. ABRASE MATING SURFACES OF THE D5134-041/-042 DAMPER SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5134-041/-042. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS. ENSURE THAT THE MS21920 CLAMPS ARE POSITIONED AS SHOWN IN DETAIL C.
- 13) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-043 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. INSTALL D5152-043 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100" MIN THK LOCATE D5152-043 USING TOOL DT10112.
- 14) INSTALL THE D5515-1 GROUNDING CLAMP AND ASSOCIATED HARDWARE PER DETAIL "C" PRIOR TO FINISHING. TORQUE THE MS21042-3 NUT 12-15 IN-LB. COMPLETELY SEAL THE EDGES OF THE CLAMP USING PROSEAL 890.
- 15) CARRY OUT A RESISTANCE CHECK BETWEEN THE D5515-1 GROUNDING CLAMP AND ANY UNPAINTED SECTION OF THE CROSSTUBE IN ACCORDANCE WITH AC43-13-1B CHAPTER 11. MAXIMUM RESISTANCE IS 3 MILLIOHMS.

RELEASED
2017-05-04
ECN 17-536

J	ADD NOTE 14 & 15 ON SHT 1, ADD PAINT/PRIMER MASKING LOCATIONS. REVISE NOTES ON SHT 1 & 4, REVISE BOM ON SHT 2 TO ADD GROUNDING CLAMP AND ASSOCIATED HARDWARE. REF PAR 17-580	ML	17.02.10
I	D6023-106 MATERIAL REPLACES D6009-106, D5136-1/-2 & D5134-041/-042 NOW INSTALLED ON PRIMER.	AP	15.10.13
H	NOTE 9 RE-WITTEN. BONDING INSTRUCTIONS MOVED TO IIN. SEE PREVIOUS REV FOR DETAILS.	AP	15.07.02
G	FINISHING ORDER ADJUSTED. UPDATE BEND TOLERANCE AND TRN DETAIL TOLERANCE TO MATCH D119-796-141 DWG	AP	15.04.24
F	REMOVED PRIMER/PAINT ON CUFFS, 2.516 WAS 2.500 (C8-5)	AP	15.02.03
E	D5152-043 WAS D5150-3, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER	DB	15.01.15
D	ADD D5150-3 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHT 1, MODIFIED NOTES ON SH 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WAS CR3212-4-05 RIVETS, RADIUS BLOCK WAS NUT PLATE ASSY (BOM), REMOVED 7.5 DEG CUFF HOLE OFFSET (A1-3), REDUCED CUFF DIA TO 2.500 (C8-5), ADD INSPECTION WINDOW	AP	14.10.23
B	ORIENTATION OF D5122-1 CENTER SUPPORT WAS CORRECTED, D5123-5 ADDED UNDER D5136-1/-2 CONTACT PADS, ADDED D2873-043 NUT PLATE ASSY & CR3212-4-05 RIVETS, ADDED REFERENCE TO SKIDTUBES FOR LOCATING CUFF HOLES, RE-ORGANIZED NOTES, REMOVED REDUNDANT INFORMATION.	AP	14.09.08
A	NEW ISSUE	AP	14.08.07
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	ML		
CHECKED	JMH	DRAWING NO.	REV. J
MFG. APPR.	DP	D119-796-241	SHEET 1 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	17.02.10	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

APPROVED

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-241	XTUBE ASSY (AW119 MKII AFT)
1	1	D119-796-241BND	CROSSTUBE, AFT
2	4	D2873-043	RADIUS BLOCK
3	1	D5122-1	CENTER SUPPORT
4	6	D5123-1	CLAMP CUSHION
5	2	D5123-5	CLAMP CUSHION
6	1	D5134-041	DAMPER SUPPORT ASSY, LH
7	1	D5134-042	DAMPER SUPPORT ASSY, RH
8	1	D5136-1	CONTACT PAD, LH
9	1	D5136-2	CONTACT PAD, RH
10	2	D5152-043	AFT POST MOUNT ASSY
11	2	D5515-1	GROUNDING CLAMP
12	16	CR3212-4-07	CSK RIVET, CHERRY MAX
13	6	MS21920-25	CLAMP
14	2	MS21920-28	CLAMP
15	2	MS27039-1-08	SCREW, PAN-HEAD
16	2	MS21042-3	NUT
17	4	NAS1149D0332J	WASHER

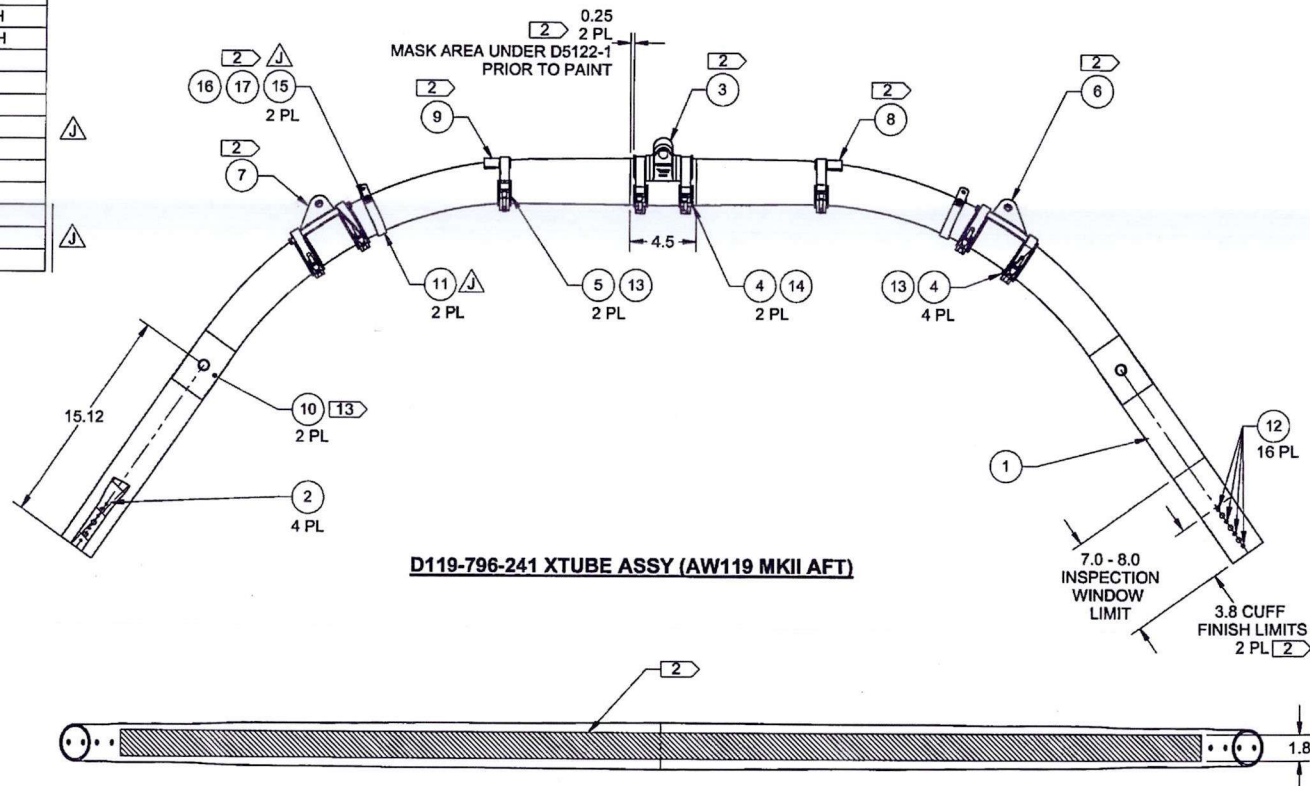



RELEASED
2017-05-04


APPROVED

DESIGN	AP
DRAWN	ML
CHECKED	JMH
MFG. APPR.	DP
APPROVED	WM
DE APPR.	DS
DATE	17.02.10

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D119-796-241	REV. J SHEET 2 OF 7
TITLE XTUBE ASSY (AW119 MKII AFT)	SCALE NTS
COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

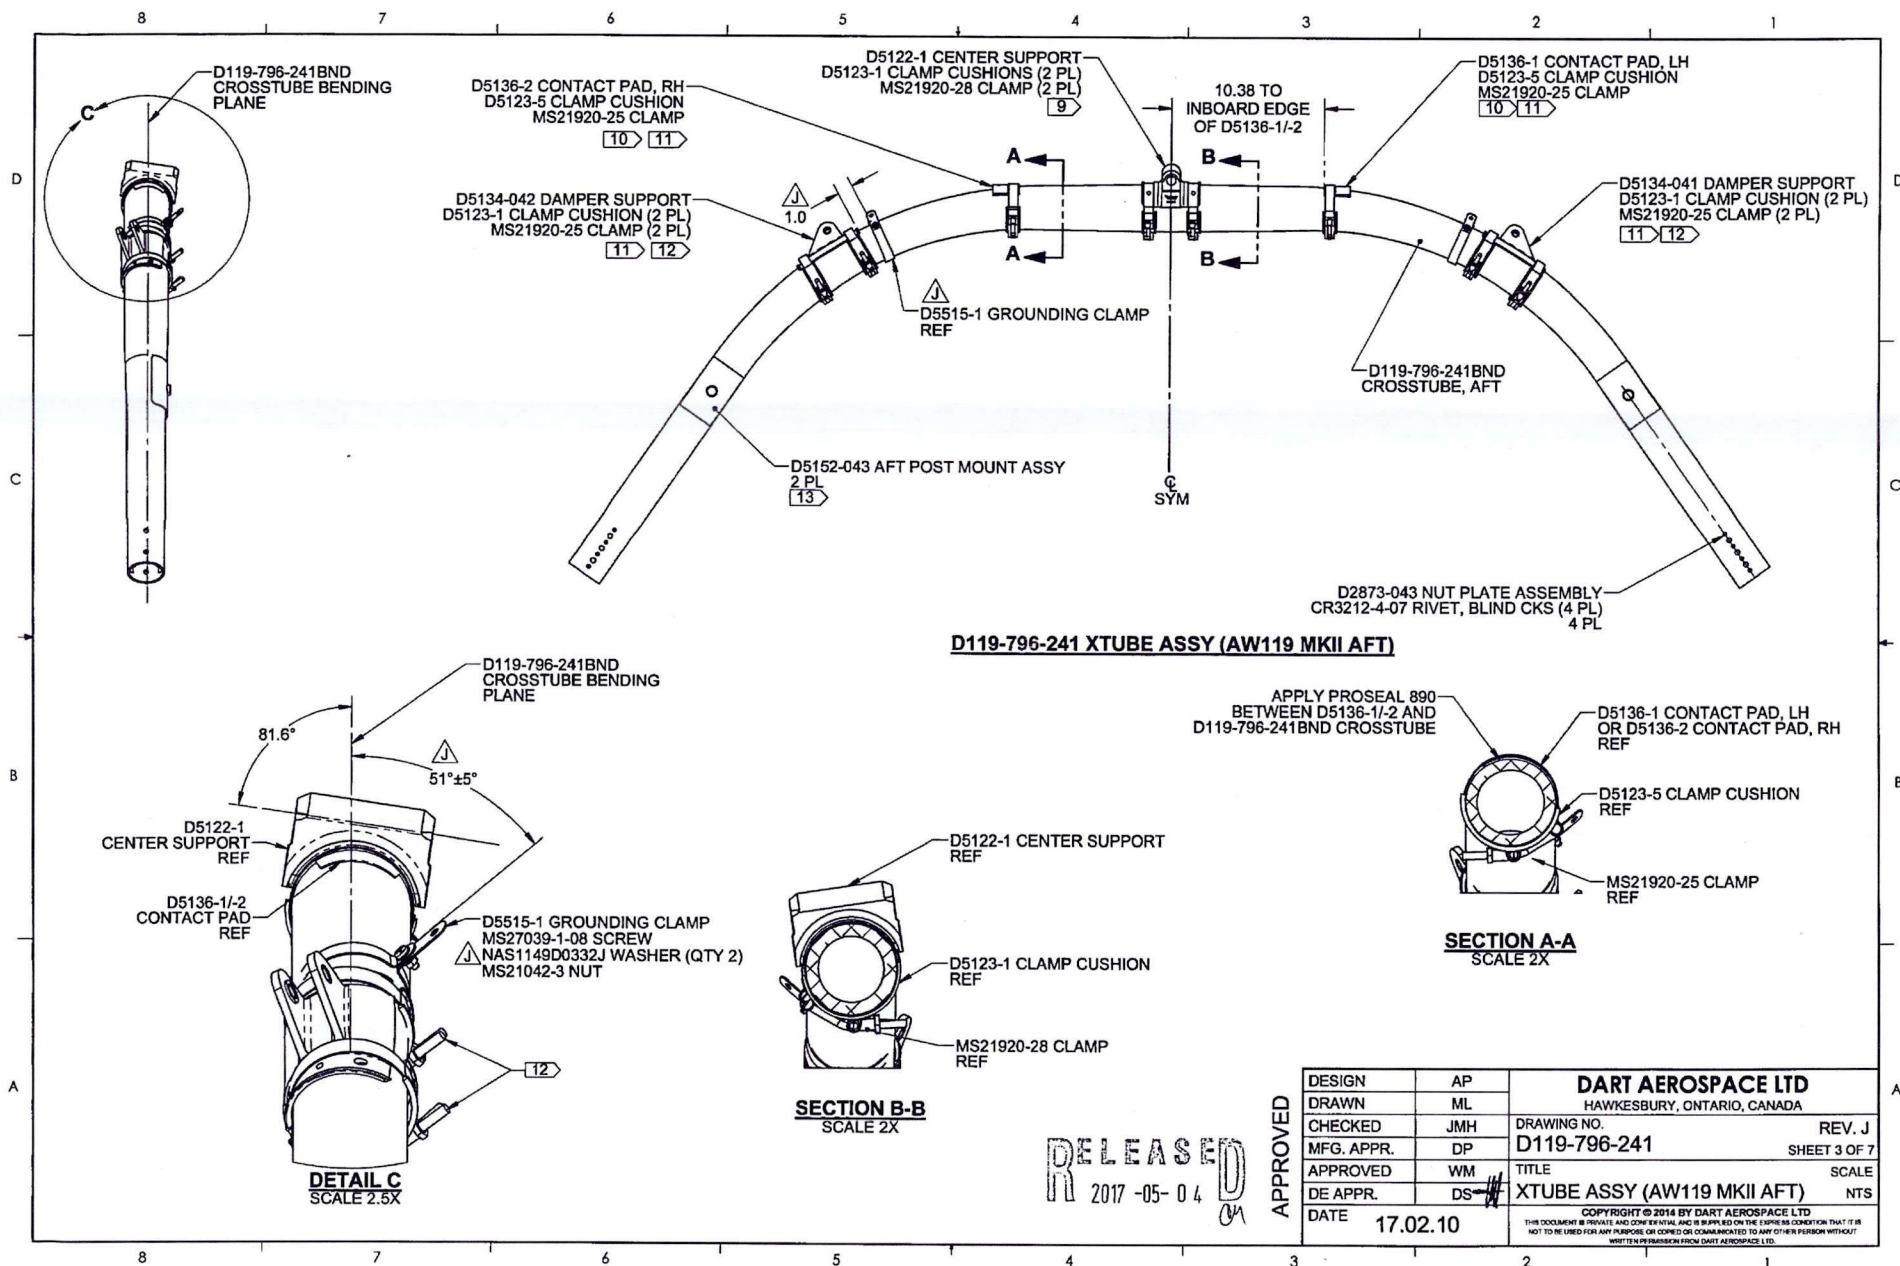


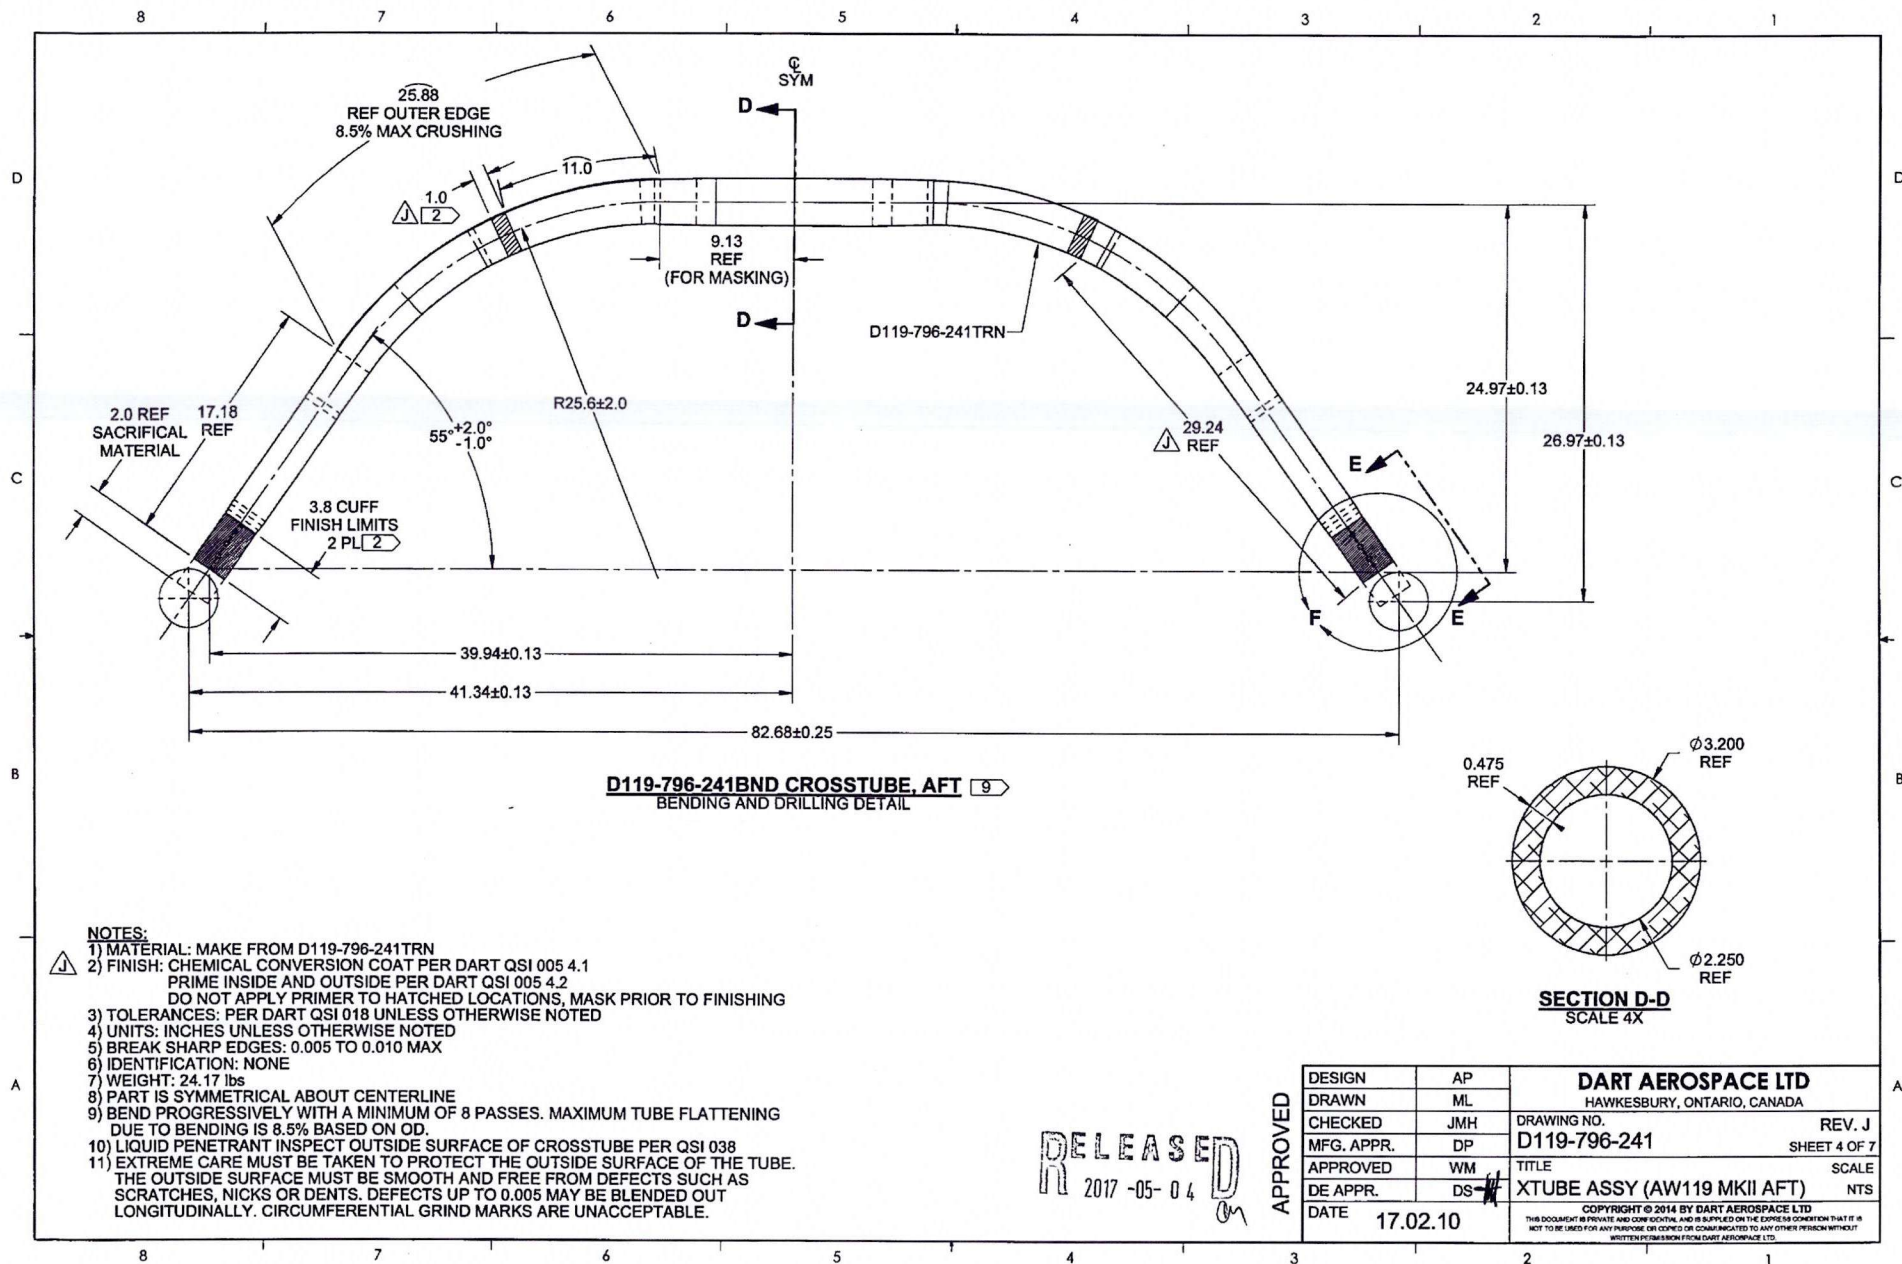


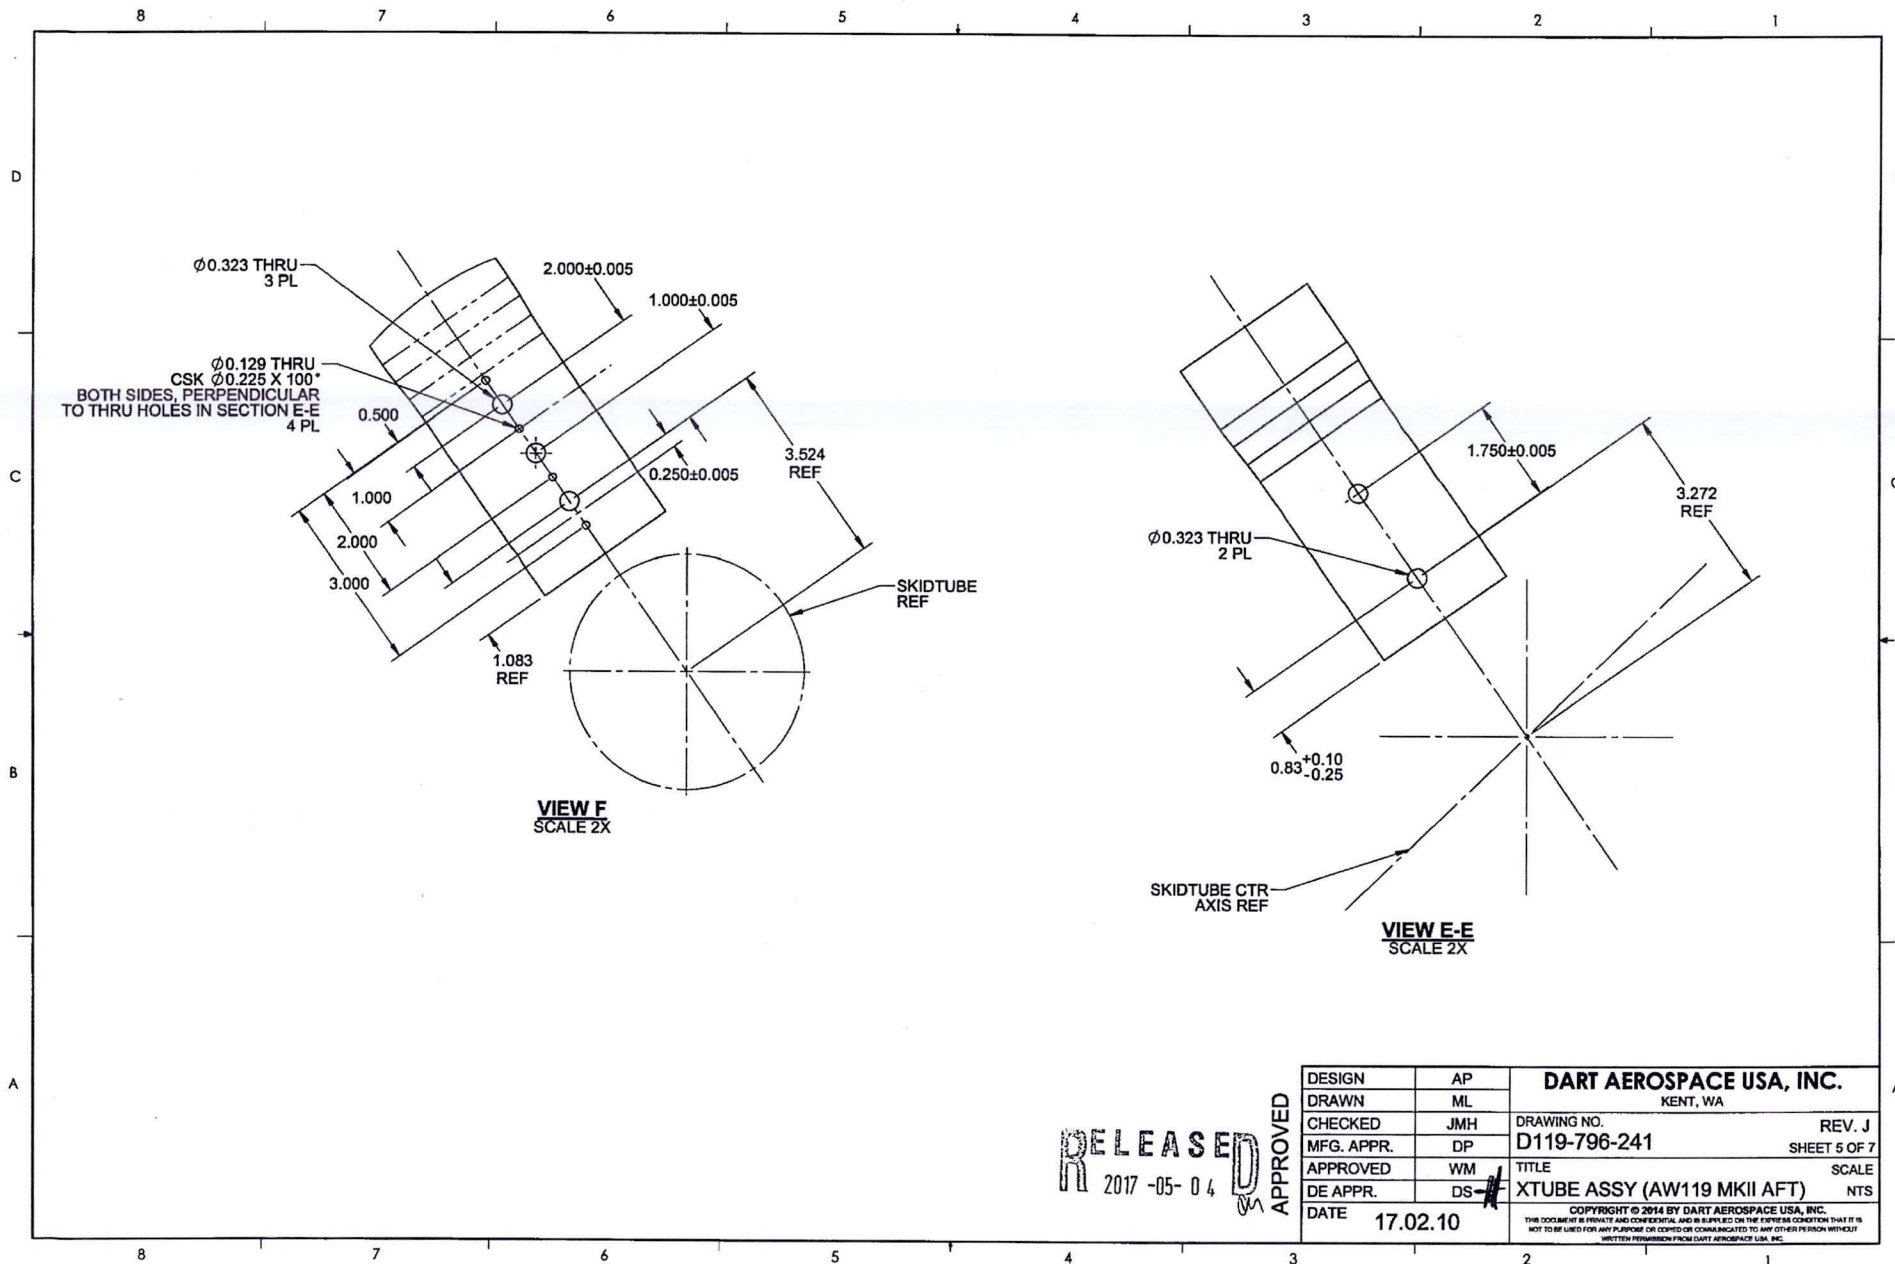

RELEASED
2017-05-04

APPROVED

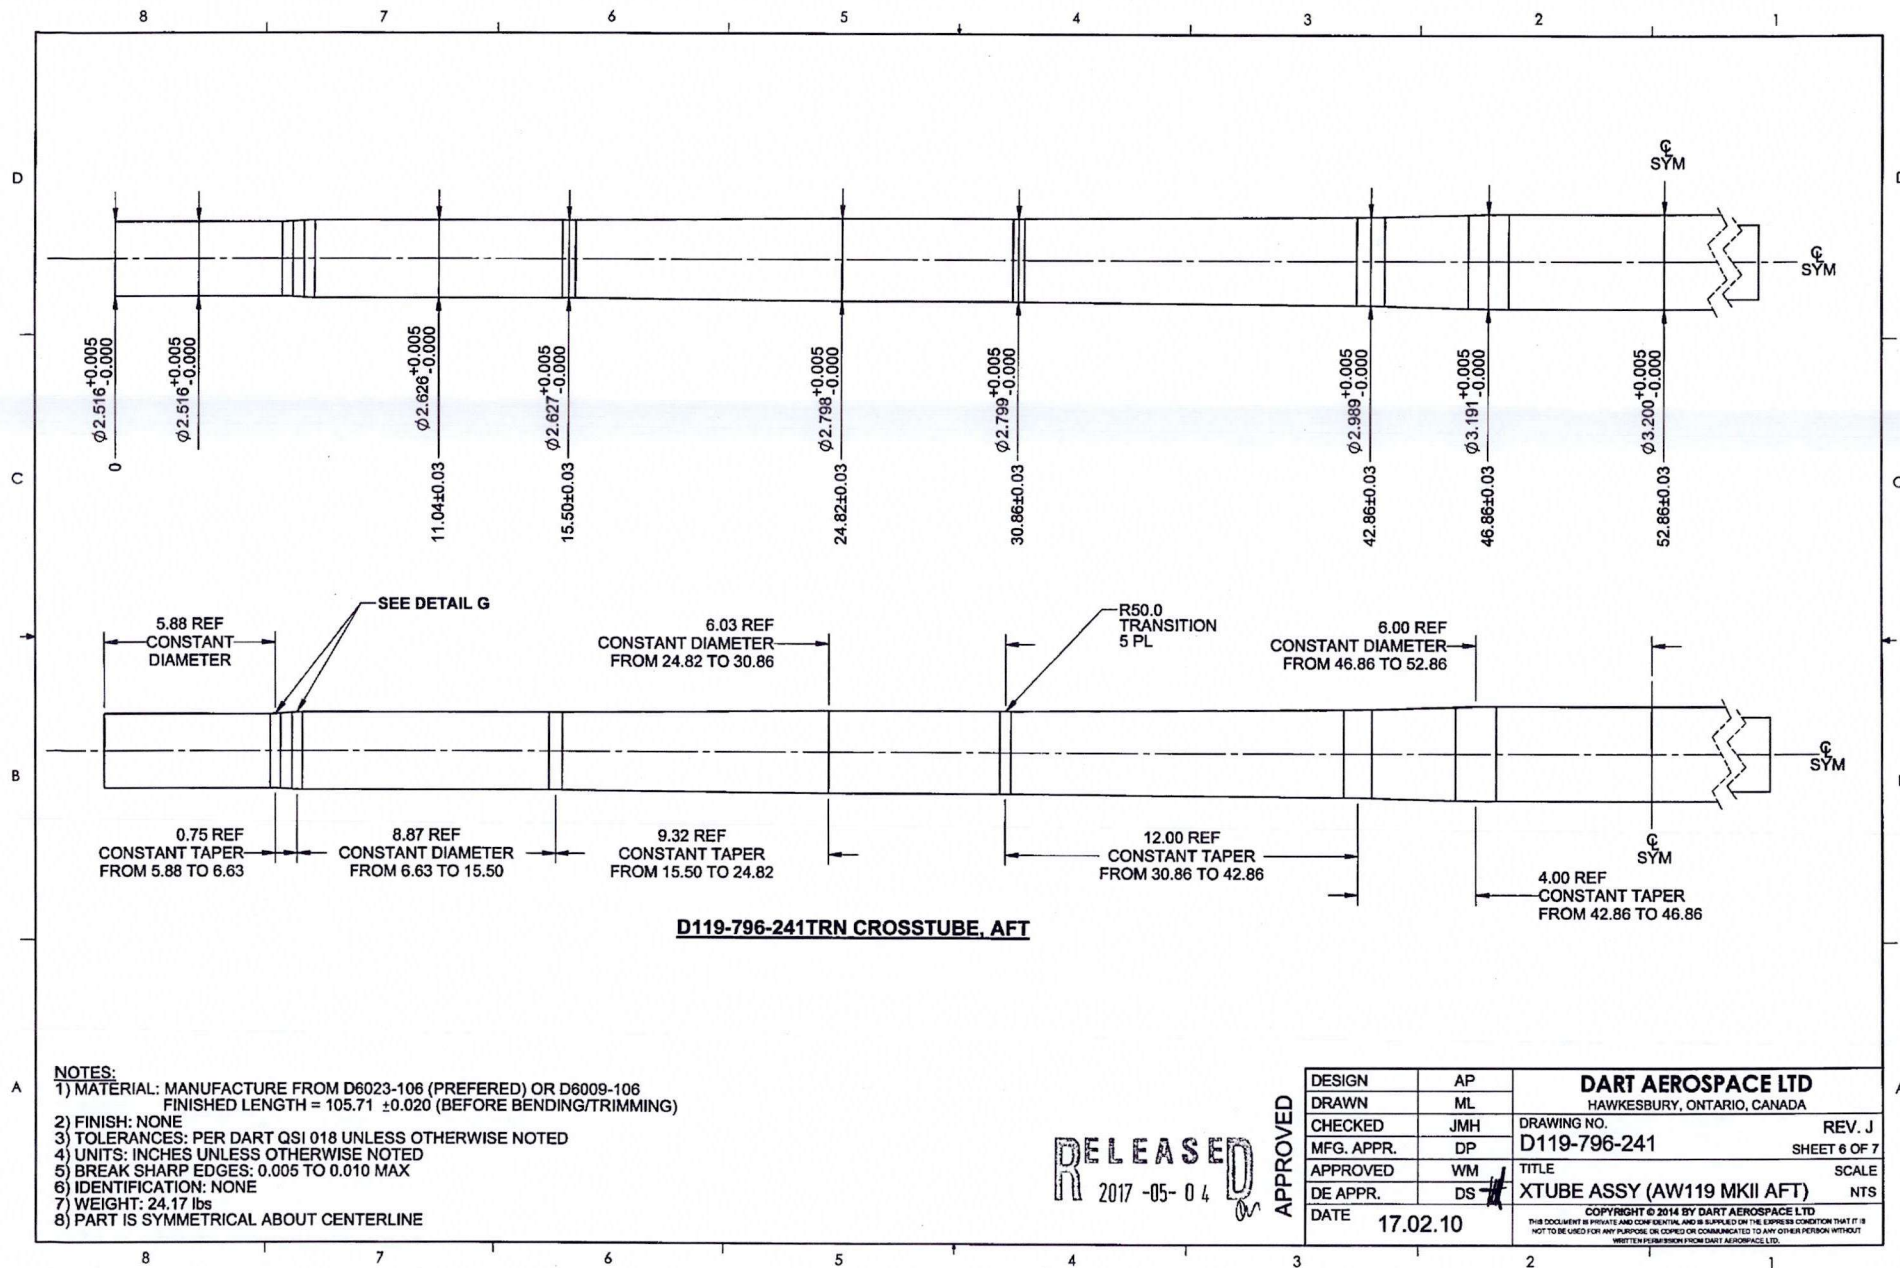

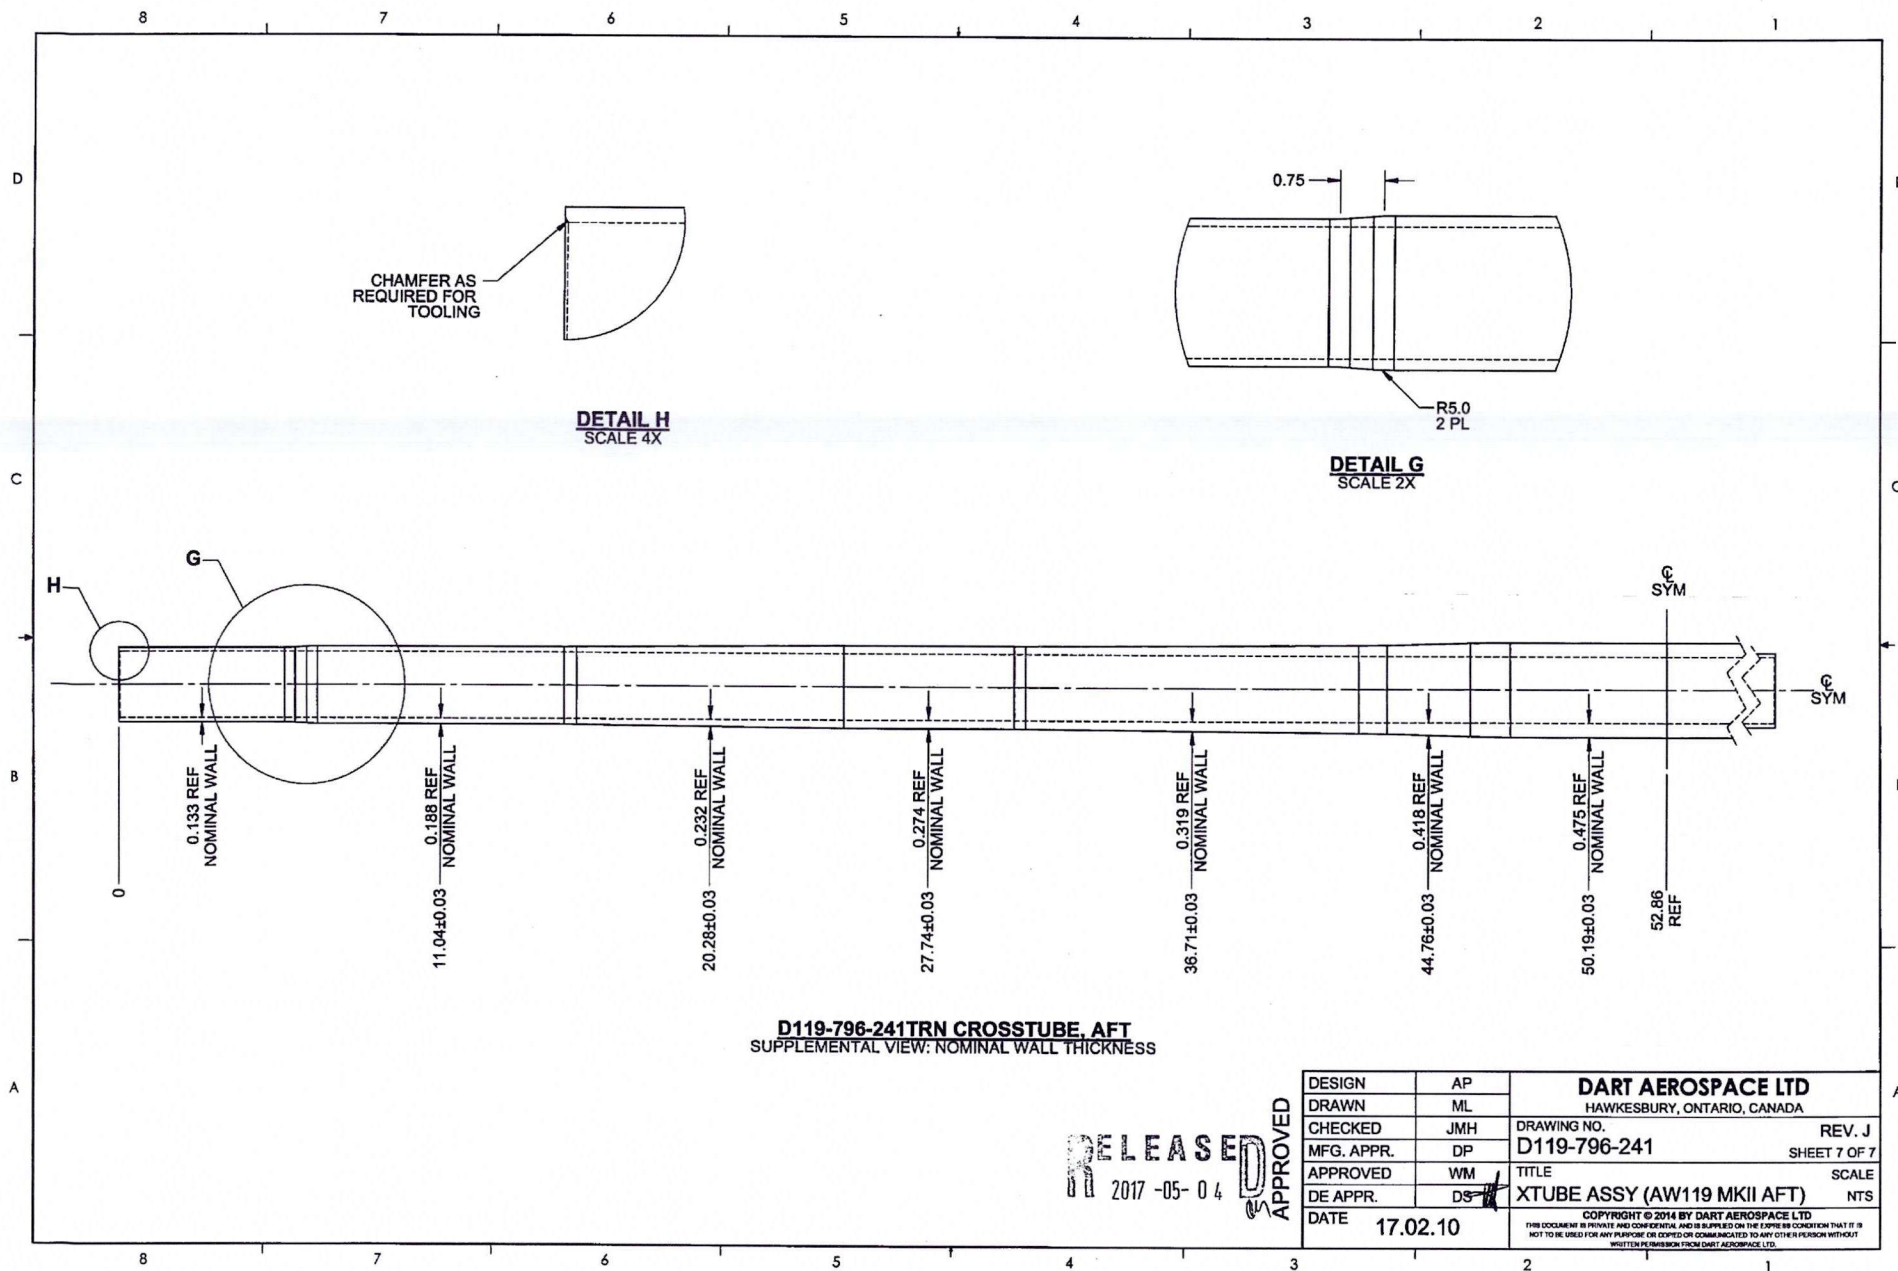

RELEASED

2017-05-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	ML	HAWKESBURY, ONTARIO, CANADA	
CHECKED	JMH	DRAWING NO.	REV. J
MFG. APPR.	DP	D119-796-241	SHEET 7 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	17.02.10	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					